



Intel® HID Event Filter

Release Notes and Bring Up Guide

September 2022

Revision 4.2

Intel Confidential



You may not use or facilitate the use of this document in connection with any infringement or other legal analysis concerning Intel products described herein. You agree to grant Intel a non-exclusive, royalty-free license to any patent claim thereafter drafted which includes subject matter disclosed herein.

No license (express or implied, by estoppel or otherwise) to any intellectual property rights is granted by this document.

Intel technologies' features and benefits depend on system configuration and may require enabled hardware, software or service activation. Learn more at [Intel.com](https://www.intel.com), or from the OEM or retailer.

No computer system can be absolutely secure. Intel does not assume any liability for lost or stolen data or systems or any damages resulting from such losses.

The products described may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are available on request.

Intel disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade.

Intel technologies' features and benefits depend on system configuration and may require enabled hardware, software or service activation. Learn more at [intel.com](https://www.intel.com), or from the OEM or retailer.

All information provided here is subject to change without notice. Contact your Intel representative to obtain the latest Intel product specifications and roadmaps.

Copies of documents which have an order number and are referenced in this document may be obtained by calling 1-800-548-4725 or visit www.intel.com/design/literature.htm.

By using this document, in addition to any agreements you have with Intel, you accept the terms set forth below.

Contact your local Intel sales office or your distributor to obtain the latest specifications and before placing your product order.

Intel and Intel logo are trademarks of Intel Corporation in the U.S. and/or other countries.

*Other names and brands may be claimed as the property of others.

Copyright © 2021, Intel Corporation. All rights reserved.

Contents

| | | |
|-------|--|----|
| 1 | Introduction | 7 |
| 1.1 | Purpose and Scope of Document..... | 7 |
| 1.2 | Acronyms and Terminology | 7 |
| 1.3 | Reference Documents..... | 9 |
| 2 | Release Kit Summary | 10 |
| 2.1 | Release Kit Details | 10 |
| 2.2 | Kit Contents | 10 |
| 3 | Architecture | 11 |
| 3.1 | Intel® HID Event Filter Driver on Windows* 8.1 versus Windows* 10 | 12 |
| 3.2 | Intel® HID Event Filter Driver Requirements | 12 |
| 3.2.1 | _DSM Function ID Definitions | 13 |
| 3.3 | Operating Modes..... | 16 |
| 4 | Important Notes | 19 |
| 4.1 | New Features: | 19 |
| 4.2 | Button Support:..... | 19 |
| 4.3 | BTNE (Button Enable): | 20 |
| 4.4 | BTNS (Button Status):..... | 21 |
| 5 | Driver Installation | 23 |
| 5.1 | Driver Installation via Installer | 23 |
| 5.2 | Silent Driver Installation via Installer..... | 23 |
| 5.3 | Checking the Driver Version | 23 |
| 5.4 | Uninstalling the Driver via Control Panel | 24 |
| 6 | Intel® Virtual Buttons Feature merged to Intel® HID Event Filter Driver..... | 25 |
| 7 | Known Issues..... | 26 |
| 8 | Closed Issues..... | 27 |

Figures

| | |
|---|----|
| Figure 1: Button/Indicator Implementation in SKL/KBL/APL | 11 |
| Figure 2. Uninstall a program | 24 |
| Figure 3. Flow diagram of Canon Lake and beyond Intel® HID Event filter Driver | 25 |

Tables

| | |
|---|----|
| Table 1: DSM Function ID | 14 |
| Table 2: Supported keys..... | 16 |
| Table 3: Button notification code meaning | 19 |
| Table 4: Button notifications | 20 |



Revision History

| Revision Number | Description | Revision Date |
|-----------------|--|----------------|
| 0.6 | <ul style="list-style-type: none"> Skylake Windows* 10 Beta Release | March, 2015 |
| 0.8 | <ul style="list-style-type: none"> Skylake Windows* 8.1 Production Candidate (PC) Release | May, 2015 |
| 0.9 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 Certified Driver | June, 2015 |
| 1.0 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 8.1 Certified Driver | June, 2015 |
| 1.1 | <ul style="list-style-type: none"> Intel HID Event Filter Windows* 10 TH2 Certified Driver Supports Windows* 10 TH2 Device Guard Feature requirement. | October, 2015 |
| 1.2 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 TH2 HotFix1 Certified Driver ver1.1.0.311 Supports Windows* 10 TH2 Device Guard Feature requirement. | November, 2015 |
| 1.3 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 TH2 Certified Driver ver 1.1.0.313 Supports Windows* 10 TH2 Device Guard Feature requirement. | February, 2016 |
| 1.4 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 Certified Driver ver 1.1.0.317 Supports Windows* 10 TH2 Device Guard Feature requirement. Updated Section 7: Closed issues list. | July, 2016 |
| 1.5 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS1 certified ver 1.1.0.317 Hardware Requirement in Section 1.1 updated | September 2016 |
| 1.6 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS1 certified ver 1.1.0.318 Hardware Requirement in Section 1.1 updated | November 2016 |
| 1.7 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS2 certified ver 2.2.1.349 | August 2017 |
| 1.8 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS3 certified ver 2.2.1.364 | November 2017 |
| 1.9 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS3 certified ver 2.2.1.370 | March 2018 |
| 2.0 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS3 certified ver 2.2.1.372 | March 2018 |
| 2.1 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS4 certified ver 2.2.1.372 | June 2018 |
| 2.2 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS4 certified ver 2.2.1.375 | December 2018 |
| 2.3 | <ul style="list-style-type: none"> Added chapter 6 Intel® Virtual Buttons Feature merged to Intel® HID Event Filter Driver Updated to new template | January 2019 |
| 2.4 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS3 certified ver 2.2.1.377 | April 2019 |
| 2.5 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS4 certified ver 2.2.1.377 | April 2019 |

| | | |
|-----|--|-----------------|
| 2.6 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS5 certified ver 2.2.1.377 | April 2019 |
| 2.7 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 19H1 certified ver 2.2.1.377 | May 2019 |
| 2.8 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 19H1 certified ver 2.2.1.378 Added support for the WCOS Complicance | October 2019 |
| 2.9 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 19H1 certified ver 2.2.1.379 Added new ACPI ID for TGL | December 2019 |
| 3.0 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 19H1 certified ver 2.2.1.380 Added new ACPI ID for RKL | March 2020 |
| 3.1 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS5 certified ver 2.2.1.379 | May 2020 |
| 3.2 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 20H1 certified ver 2.2.1.379 | May 2020 |
| 3.3 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 20H1 certified ver 2.2.1.377 | May 2020 |
| 3.4 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 20H1 certified ver 2.2.1.381 Added new ACPI ID for ADL | June 2020 |
| 3.5 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 20H1 certified ver 2.2.1.383 Added new ACPI ID for JSL and MTL | August 2020 |
| 3.6 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS5, 19H1, 20H1 certified ver 2.2.1.383 | September 2020 |
| 3.7 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 20H1 certified ver 2.2.1.384 | September 2020 |
| 3.8 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 20H1 certified ver 2.2.1.384 | December 2020 |
| 3.9 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10 RS5,19H1, 20H1 certified ver 2.2.1.384 | December 2020 |
| 4.0 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10, Windows* 11 RS5,19H1, 20H1, 21H2 certified ver 2.2.1.386 | July, 2021 |
| 4.1 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10, Windows* 11 RS5,19H1, 20H1, 21H2, 22H2 certified ver 2.2.1.386 | June, 2022 |
| 4.2 | <ul style="list-style-type: none"> Intel® HID Event Filter Windows* 10, Windows* 11 RS5,19H1, 20H1, 21H2, 22H2 certified ver 2.2.1.386_v4 re-sign | September, 2022 |

1 Introduction

1.1 Purpose and Scope of Document

This document provides installation instructions and general usage of the driver as well as release information, such as release kit summary, important notes, resolved issues and known issues. This document is intended to help OEM and ODM customers setup their platform as they prepare for validation and debug.

Intel® HID Event Filter driver allows the SBIOS to send Intel® HID messages and button events to the operating system for various key presses. The driver supports the following operating system and platform:

Operating System:

- Windows* 8.1 Operating System
- Windows* 10 Operating System
- Windows* 11 Operating System

Hardware Requirement:

- Kaby Lake Platforms
- Amber Lake Platforms
- Cannon Lake Platforms
- Coffee Lake Platforms
- Gemini Lake Platforms
- Apollo Lake Platforms
- Whiskey Lake Platforms
- Comet Lake Platforms
- Icelake Platforms
- Jasper Lake
- Tiger Lake Platforms
- Rocket Lake
- Alder Lake
- Raptor Lake
- Meteor lake

1.2 Acronyms and Terminology

| Term | Description |
|------|--|
| ACPI | Advanced Configuration and Power Interface |

| Term | Description |
|-------------|-------------------------------------|
| ASL | ACPI Source Language |
| BTNE | Button Enable |
| BTNS | Button Status |
| BTNC | Button Control |
| BTNL | Button Load |
| BDW | Broadwell |
| BSW | Braswell |
| BYT | Bay Trail |
| EC | Embedded Controller |
| HSW | Haswell |
| HID | Human Interface Devices |
| MSFT | Microsoft |
| RVP | Reference Validation Platform |
| SKL | Skylake |
| KBL | Kabylake |
| SBIOS | System BIOS |
| GPIO | General Purpose IO |
| HDMM | Intel® HID Driver Mode Method |
| HDSM | Intel® HID Driver Status Method |
| HDEM | Intel HID Driver Event Method |
| HDDM | Intel® HID Driver Descriptor Method |
| MTL | Meteor Lake |

Introduction

| Term | Description |
|------|----------------------|
| PC | Production Candidate |
| PV | Production Version |
| RPL | Raptor Lake |
| WHL | Whiskey Lake |
| ICL | IceLake |

1.3 Reference Documents

| Document | Document No./Location |
|--|------------------------|
| BIOS Enabling Guide for Windows* 10 | 557130 |

2 *Release Kit Summary*

2.1 Release Kit Details

Kit Name: Intel®HID EventFilterDriver_v2.2.1.386_v4_22H2_21H2_20H1_19H1_RS5 Signed Driver Release

- Intel® HID Event Filter driver_version_2.2.1.386_v4

2.2 Kit Contents

The contents of this release kit include: Intel® HID Event Filter.

The driver installer compose of the following modules:

- Intel® HID EventFilterDriver_v2.2.1.386_v4_22H2_21H2_20H1_19H1_RS5 Signed Driver Release
- Intel® HID Event Filter Driver Release Notes and Bring Up Guide Software License Agreement

3 Architecture


The path to Intel® HID Event handling starts with a platform specific Hardware Event and continues up the software stack until it is serviced by the operating system. With the exception of the hardware event and the specific Intel® HID Message to service, a complete solution is being provided to support Intel HID Messaging while using PS2 Keyboard Controllers.

Intel® Event Handling:

1. Operating System Services Intel® HID
2. Hardware Event is generated.
3. Hardware Event is sent to SBIOS
4. SBIOS passes the event notification to Intel® HID event filter driver
5. Intel® HID Event Filter Driver passes Intel® HID Message onto

The below picture explains the buttons and indicator implementation on Windows* 8.1 vs Windows* 10.

Figure 1: Button/Indicator Implementation in SKL/KBL/APL

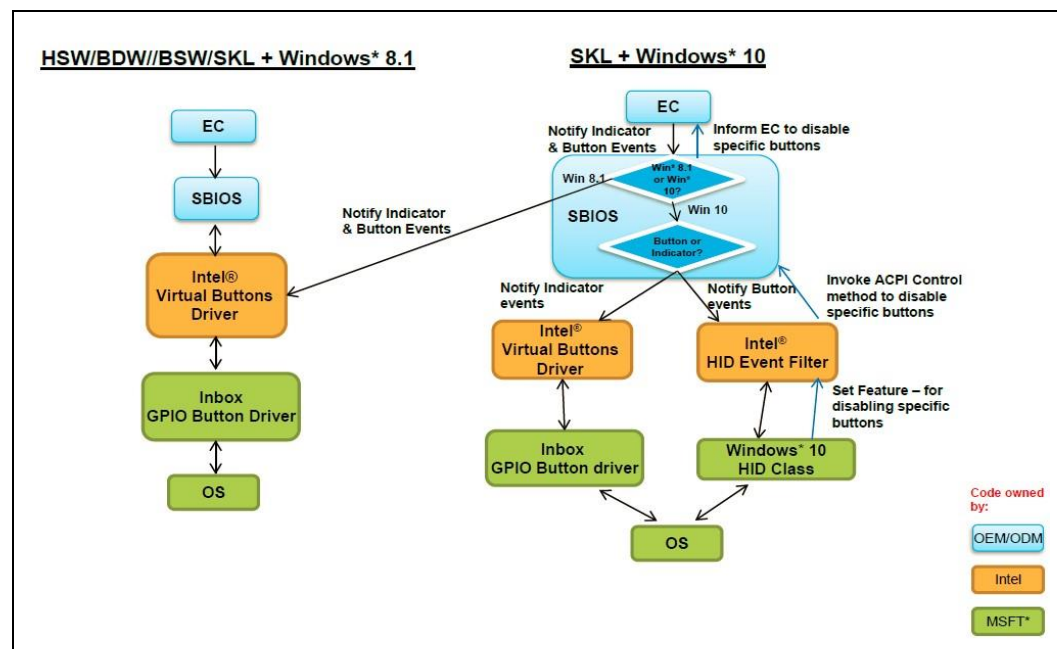

3.1 Intel® HID Event Filter Driver on Windows* 8.1 versus Windows* 10

Windows* 8.1:

- EC notifies System BIOS of buttons and indicator events. The System BIOS uses ACPI control method to send notifications to communicate with the Virtual GPIO Buttons Driver.
- Driver services ACPI notifications from System BIOS and passes button/indicator State changes to the OS inbox buttons driver via exposed interface.

Windows* 10:

- EC notifies System BIOS of buttons and indicator events. The system BIOS will check for the OS version.
- If it is Windows* 10, the Indicator events are sent to Intel® Virtual Buttons Driver and the driver services ACPI notifications from System BIOS and passes indicator state changes to the OS inbox buttons.
- The Button events are sent to Intel® HID Event Filter driver and the driver services. ACPI notifications from System BIOS and passes button events to the Windows* 10 Intel® HID Class Driver

3.2 Intel® HID Event Filter Driver Requirements

The following settings should be implemented:

- Define input reports for 5 button array (Volume up/down buttons, power button, Windows button and Rotation lock/unlock button). Refer to Table 3 for code and definition.
- Process the button events from BIOS and send corresponding input reports to Windows* 10 OS HID Class Filter Driver.
- Apart from processing the button events, the Intel® HID Filter Driver for Windows* 10 will also support:
 - A "Set Feature" which will enable/disable specific buttons:
 - Add support for Set Feature request which is initiated by OS HID stack to disable specific button(s)
 - Invoke ACPI control method (BTNE – Button Enable) to enable/disable specific buttons

Architecture

- A “Get Feature” request which will query status of specific buttons:
 - Add support for Get Feature request w
 - hich is initiated by OS HID stack to query status of specific button(s)
 - Query button status during driver load and Modern Standby/S3/S4 resume. ACPI control method (BTNS – Button Status) to query status of specific buttons

3.2.1 ACPI ID's

The following are the ACPI ID's supported for the Intel HID Event Filter Driver

- INT33D5
 - AML, GLK, CNL, WHL, ICL, CML
- INTC1051
 - TGL
- INTC1054
 - RKL
- INTC1070
 - ADL
- INTC1076
 - JSL
- INTC1077
 - MTL
- INTC1078
 - RPL

3.2.2 _DSM Function ID Definitions

The following functions shall be supported for the Intel HID Event Filter Driver _DSM

- Function 0: Returns a buffer with a bit-field representing the supported function IDs: Table 1 Supported keys

Table 1: DSM Function ID

| Function Index | ASL Object |
|----------------|---|
| 1 | <p>BTNL</p> <p>Button Load Method: This method will be called upon loading of the HID Event Filter Driver. The intent of this method is to have a mechanism by which to seamlessly switch from the 4s Power Button behavior to the 10s Power Button behavior. This is a parameterless control method. If the 10s Power Button is enabled, then this method is responsible for sending the 10s Power Button command to the EC.</p> |
| 2 | <p>HDMM</p> <p>HID Driver Mode Method. BIOS to return the mode -> 0 = Simple</p> |
| 3 | <p>HDSM</p> <p>HID Driver Status Method. The driver will call this ASL function during D0 entry and D0 exit to let the platform know its current status. 0 - Driver not available. 1 - Driver available.</p> |
| 4 | <p>HDEM</p> <p>HID Driver Event Method. BIOS to return the index of a mode 0 supported BTNEkey.</p> <p>Refer to table (1) below for the index to be returned.</p> |
| 5 | <p>BTNS</p> <p>Button Status Method to query if specific buttons are enabled/disabled. BIOS to return a 32 bit value with the following definition, for button status</p> <p>Bits [5-31] - Reserved</p> <p>Bits [4] – Rotation Lock Button status 0 = Rotation Lock Button is disabled 1 = Rotation Lock Button is enabled</p> <p>Bits [3] – Volume Down Button status 0 = Volume Down Button is disabled 1 = Volume Down Button is enabled</p> <p>Bits [2] – Volume Up Button status</p> |

| | |
|---|---|
| | <p>0 = Volume Up Button is disabled 1 = Volume Up Button is enabled</p> <p>Bits [1] – Windows Button status 0 = Windows Button is disabled 1 = Windows Button is enabled</p> <p>Bits [0] – Power Button status 0 = Power Button is disabled 1 = Power Button is enabled</p> |
| 6 | <p>BTNE Button Enable/Disable Method To Enable/Disable specific buttons. 32 bit value with the following definition, sent to BIOS to enable/disable buttons</p> <p>Bits [5-31] - Reserved</p> <p>Bits [4] – Rotation Lock Button 0 = Rotation Lock Button needs to be disabled 1 = Rotation Lock Button needs to be enabled</p> <p>Bits [3] – Volume Down Button 0 = Volume Down Button needs to be disabled 1 = Volume Down Button needs to be enabled</p> <p>Bits [2] – Volume Up Button 0 = Volume Up Button needs to be disabled 1 = Volume Up Button needs to be enabled</p> <p>Bits [1] – Windows Button 0 = Windows Button needs to be disabled 1 = Windows Button needs to be enabled</p> <p>Bits [0] – Power Button 0 = Power Button needs to be disabled 1 = Power Button needs to be enabled</p> |
| 7 | <p>HEBC (v1)</p> <p>To query buttons implemented on the platform. BIOS to return a 32 bit value with the definition marked in table (2) below.</p> |

| | |
|---|---|
| 8 | <p>VGBS</p> <p>Virtual GPIO Button Status: Returns status of buttons and indicators. This method returns an integer with the following bit-level definition:</p> <p>Bits [7] – Docking Indicator status 0 = Docking Indicator is in undocked mode 1 = Docking Indicator is in docked mode</p> <p>Bits [6] – Convertible Indicator status 0 = Convertible Indicator is in slate mode 1 = Convertible Indicator is in Laptop (clamshell) mode</p> <p>Bits [0 - 5] – Reserved</p> |
| 9 | <p>HEBC (v2)</p> <p>To query buttons implemented on the platform. BIOS to return a 32 bit value with the definition marked in table (3) below.</p> |

3.3 Operating Modes

Intel® HID Event Filter will support Simple Mode:

Mode 0 (Simple Mode)

This mode will be simple for the OEM to implement in the BIOS ASL but will support only a limited number of keys that can be passed through to the OS. While running in Mode 0 (Simple), the BIOS will send an ASL notification to the driver when it has a key that it is ready to send through. The driver will then call back to the BIOS to get the index that matches the key in the following table. For this specific set of keys, the driver will take care of the Intel® HID related reports, usage pages, and usage ids. The driver will build a static table in memory to get any other needed information at run time. The index is used to locate the correct row in the static table.

Supported Keys: Indexes 0 to 20 are optional and Index 27 is mandatory.

Table 2: Supported keys

| Index | Usage ID | Usage Name | Notes |
|-------|----------|---------------------------------------|--|
| 0 | - | - | Index 0 is not supported. |
| 1 | 0xE3 | Keyboard Left GUI (windows button) | Requires BIOS delay due to <Ctrl><Alt><Shift> being held for hotkey. |
| 2 | 0xE3 + | Rotation Lock | Requires BIOS delay due to |

| Index | Usage ID | Usage Name | Notes |
|-------|----------|-----------------------|--|
| | 0x69 | | <Ctrl><Alt><Shift> being held for hotkey. |
| 3 | 0x53 | Num Lock | Requires BIOS delay due to <Ctrl><Alt><Shift> being held for hotkey. |
| 4 | 0x4A | Home | Requires BIOS delay due to <Ctrl><Alt><Shift> being held for hotkey. |
| 5 | 0x4D | End | Requires BIOS delay due to <Ctrl><Alt><Shift> being held for hotkey. |
| 6 | 0x4B | Page Up | Requires BIOS delay due to <Ctrl><Alt><Shift> being held for hotkey. |
| 7 | 0x4E | Page Down | Requires BIOS delay due to <Ctrl><Alt><Shift> being held for hotkey. |
| 8 | 0xC6 | Wireless Radio Button | Implemented. Spec says this is an OOC (On/Off Control). So, we should send '0' to turn off and '1' to turn on. However, on Windows 8 it works like all of the other OSC's and it toggles when the request is sent. Windows also turns airplane mode on/off when this HID request is sent to the OS. For now the driver always sends a '1'. The behavior is the same even when sending a '0'. |
| 9 | 0x81 | System Power Down | |
| 11 | 0x82 | System Sleep | |
| 12 | 0xB5 | Scan Next Track | |
| 13 | 0xB6 | Scan Previous Track | |

| Index | Usage ID | Usage Name | Notes |
|-------|----------|------------------------------|-------|
| 14 | 0xB7 | Stop | |
| 15 | 0xCD | Play/Pause | |
| 16 | 0xE2 | Mute | |
| 17 | 0xE9 | Volume Increment | |
| 18 | 0xEA | Volume Decrement | |
| 19 | 0x6F | Display Brightness Increment | |
| 20 | 0x70 | Display Brightness Decrement | |
| 27 | 0x83 | System Wake | |

The hotkeys are supported in our test BIOS. Use <Ctrl><Alt><Shift><Hotkey> to activate.

4 *Important Notes*

4.1 **New Features:**

Below are the list of new features implemented in the Intel® HID Event Filter Driver for Windows* 10.

4.2 **Button Support:**

For Win10, we added the MSFT defined 5 button array report descriptor supporting the buttons in the HID Event Filter Driver. The 5 button events supported are Windows Home, Volume Increment, Volume Decrement, Rotation Lock and System power down.

Intel HID Event filter will process the button press and release events from BIOS and send corresponding input reports to OS

BIOS to define Press and Release Events for this 5 button array.

Table 3: Button notification code meaning

| Button Notification Value | Meaning |
|---------------------------|--|
| 0xC2 | Windows Home Button has been pressed |
| 0xC3 | Windows Home Button has been released |
| 0xC4 | Volume Up Button has been pressed |
| 0xC5 | Volume Up Button has been released |
| 0xC6 | Volume Down Button has been pressed |
| 0xC7 | Volume Down Button has been released |
| 0xC8 | Rotation Lock Button has been pressed |
| 0xC9 | Rotation Lock Button has been released |
| 0xCE | Power Button has been pressed |
| 0xCF | Power Button has been released |

Table 4: Button notifications

| Usage ID | Usage Name | Notes |
|----------|-------------------|--|
| 0xE3 | Windows Home | BIOS defined ACPI notifications processed for press and release events |
| 0xCA | Rotation Lock | BIOS defined ACPI notifications processed for press and release events |
| 0x81 | System Power Down | BIOS defined ACPI notifications processed for press and release events |
| 0xE9 | Volume Increment | BIOS defined ACPI notifications processed for press and release events |
| 0xEA | Volume Decrement | BIOS defined ACPI notifications processed for press and release events |

Important Note: The SKL BIOS ASL code and EC reference code for Skylake/Kabylake will include all the details on how to implement the new features mentioned in the previous sections. Customer can also implement the same EC/BIOS changes in their HSW/BDW EC and BIOS if they want to take advantage of the new features.

4.3 BTNE (Button Enable):

Intel® HID Event Filter driver has an additional support for Set feature request - Initiated by OS HID Stack to disable specific buttons. This invokes ACPI control method (BTNE - Button Enable) to disable specific buttons

BIOS sends ACPI control method (BTNE - Button Enable) to HID Event Filter driver enable/disable specific buttons.

0: Disabled

1: Enabled

Bits [5-31] - Reserved

Bits [4] – Rotation Lock Button

0 = Rotation Lock Button needs to be disabled

1 = Rotation Lock Button needs to be enabled

Bits [3] – Volume Down Button

0 = Volume Down Button needs to be disabled

1 = Volume Down Button needs to be enabled

Important Notes

Bits [2] – Volume Up Button

- 0 = Volume Up Button needs to be disabled
- 1 = Volume Up Button needs to be enabled

Bits [1] – Windows Button

- 0 = Windows Button needs to be disabled
- 1 = Windows Button needs to be enabled

Bits [0] – Power Button

- 0 = Power Button needs to be disabled
- 1 = Power Button needs to be enabled

4.4 BTNS (Button Status):

Intel® HID Event Filter also supports the 'Get feature request' - Initiated by OS HID Stack to query if a button is enabled/disabled. Intel® will Query Button status during driver load and CS/S3/S4 resume using ACPI control method (BTNS - Button Status)

BIOS implements ACPI control method (BTNS - Button Status) to query specific buttons that are enabled/disabled (BTNS needs to return status of all buttons as enabled on initial boot). This method returns the button status as an integer with the following button bit-level definition.

0: Disabled

1: Enabled

Bits [5-31] - Reserved

Bits [4] – Rotation Lock Button status

- 0 = Rotation Lock Button is disabled
- 1 = Rotation Lock Button is enabled

Bits [3] – Volume Down Button status

- 0 = Volume Down Button needs to be disabled
- 1 = Volume Down Button needs to be enabled

Bits [2] – Volume Up Button

- 0 = Volume Up Button needs to be disabled
- 1 = Volume Up Button needs to be enabled

Bits [1] – Windows Button

- 2 = Windows Button needs to be disabled
- 3 = Windows Button needs to be enabled

Bits [0] – Power Button

- 2 = Power Button needs to be disabled
- 3 = Power Button needs to be enabled

Note:

- BIOS implements ACPI control method (BTNC - Capability Query) to query buttons implemented on the platform
- BIOS also implements ACPI control method (BTNL - Button Load) - This method will be called upon loading of the HID Event Filter Driver. For enabling 10s Power Button, this method is responsible for sending the 10s Power Button command to the EC.
- EC to support a method for BIOS to inform EC to disable specific buttons: home, volume up, volume down, rotation lock.

5 Driver Installation

Note: A supported Operating System must be installed prior to the installation of the Intel® HID Event Driver.

There are two different methods to install the Intel® HID event filter driver for this release:

- a. Driver Installation via Installer
- b. Silent Driver Installation via Installer

5.1 Driver Installation via Installer

To install the Intel® HID Event Driver following steps must be taken:

1. Update the test system with BIOS that supports the INT33D5 ACPI device.
2. Install a new copy of Windows* 8.1 or Windows* 10.
3. Copy the installation package to the test machine.
4. Run the setup.exe program from within the Driver_Installer folder from the release package and follow the steps in the following windows.

5.2 Silent Driver Installation via Installer

Follow the steps listed below for silent driver installation via installer:

1. Open a Command Prompt (cmd.exe) with administrator rights (i.e. Run as Administrator). Click on 'Yes' button in User Account Control pop-up window.
2. Switch to the Intel HID installer
3. Setup.exe -s

5.3 Checking the Driver Version

To check the Intel® HID Event Driver version, follow the below instructions:

1. Open Device Manager.
2. In View, select "show hidden devices" Click on Human Interface Devices.
3. Double click on "Intel® HID Event Filter"
4. Select the "Driver" tab and the Driver Version will be listed.

5.4 Uninstalling the Driver via Control Panel

Follow the steps listed below to uninstall the driver via the Control Panel:

1. Open the Control Panel window.
2. If the Control Panel window is shown in 'Category' view, then select "Uninstall a program" as shown in [Figure 2](#). Otherwise if the Control Panel window is shown in 'icon' view, then select "Programs and Features".
3. Follow the next windows to continue the uninstallation process. System will restart the after clicking "Finish" in the last step.

Figure 2. Uninstall a program



6 Intel® Virtual Buttons Feature merged to Intel® HID Event Filter Driver


Both Button and indicator notifications are handled by Intel® HID Event filter Driver from CNL and beyond for Windows 8.1/10.

For Sky lake/Kaby lake/Apolo lake there were two separate driver for Button and Indicator events

- Indicator events are handled by Intel® Virtual Button Driver
- Button events are handled by Intel® HID Event filter Driver

From Cannon Lake and beyond both events are solely handled by Intel® HID Event filter Driver. Refer **Table 4** for more details on button events.

Figure 3. Flow diagram of Canon Lake and beyond Intel® HID Event filter Driver

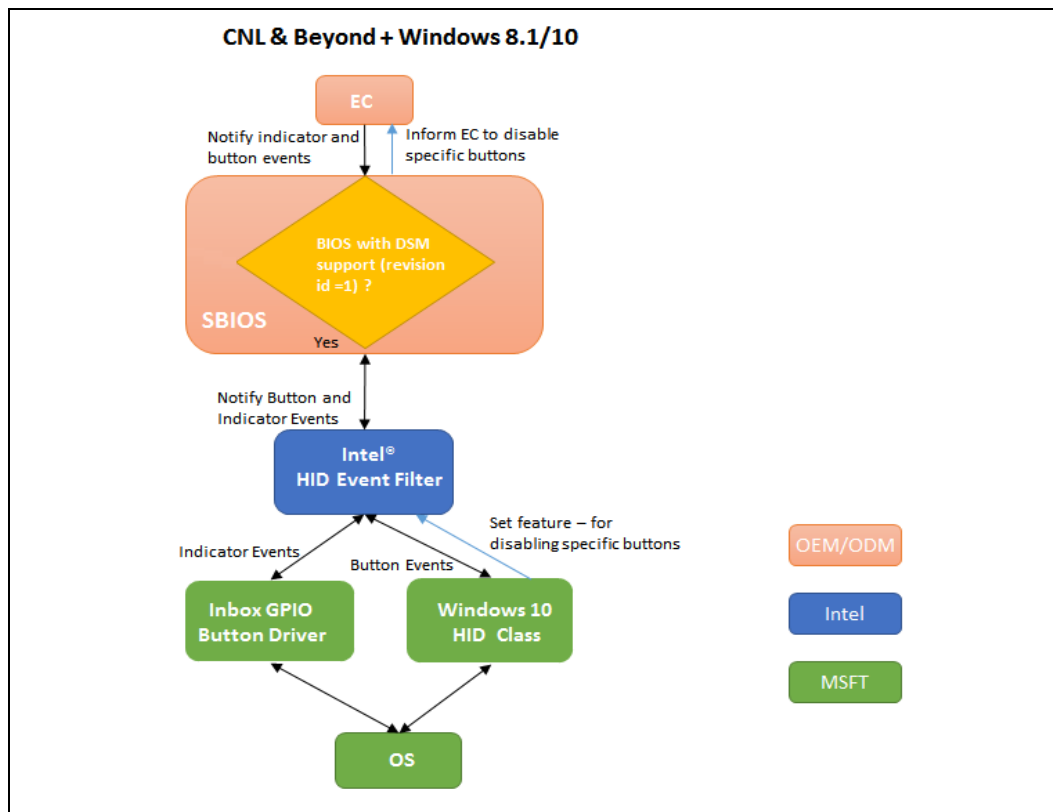

7 *Known Issues*

| Issues | Description |
|--------|-------------|
| | |
| | |
| | |
| | |

8 Closed Issues

| Usage ID | Usage Name | Notes |
|-------------|--|--|
| NA | MUP issue fixed | Intel® HID Installer update |
| NA | Device Guard Support | Implemented in Win* 10 TH2 Release versions 1.1.0.311 and newer. |
| 1604178088 | Button functionality not working when system booted from hybrid shutdown + G3 | Fix implemented in Win* 10 Release version 1.1.0.317 |
| NA | Intel® HID Event Filter Driver v1.1.0.317 certified with Windows* 10 RS1 WHCK build | NA |
| NA | Intel® HID Event Filter v1.1.0.318 driver has the installer fix for Arabic language | Fix implemented in Win* 10 Release version 1.1.0.318 RS1 certified |
| NA | When all buttons are disabled except wireless button, wireless button functionality was missing. The new release fixes this issue. | Fix implemented in Win* 10 Release version 2.2.1.349 RS2 certified |
| 220703155 | Incorrect Ctrl+Alt+Del log on message with HID Event filter driver | Fix implemented in Win* 10 Release version 2.2.1.364 RS3 certified |
| 1406931657 | BTNL Method updated in HID Event Filter Driver | Fix implemented in Win* 10 Release version 2.2.1.372 RS3 certified |
| 2202801616 | [HID] - Setup.exe crashes during the buffer overflow check | Fix implemented in Win* 10 Release version 2.2.1.375 RS5 certified |
| NA | RS5 certification included. | Fix implemented in Win* 10 Release version 2.2.1.375 RS5 certified |
| 2206391149 | Public Symbol mismatch on HidEventFilter.sys | Fix implemented in Win*10 Release version 2.2.1.377 RS4, RS5 Certified |
| NA | MUP issue fixed | Fix implemented in Win*10 Release version 2.2.1.377 RS3,RS4, RS5 Certified |
| NA | Support for WCOS Compliance | Fix implemented in Win*10 Release version 2.2.1.378 19H1 Certified |
| NA | Added new ACPI ID for TGL Platform | Implemented in Win*10 Release version 2.2.1.379 19H1 certified |
| 22011208145 | Updated installer Binaries | Implemented in Win*10 Releases version 2.2.1.383 20H1 certified |

| Usage ID | Usage Name | Notes |
|-------------|--|---|
| 22011270825 | LaptopSlate/dock interface change PnP registration is done only when DSM VGBS method is supported | Implemented in Win*10 Releases version 2.2.1.384 20H1 certified |
| 22011382096 | Fixed uninstallation error in when uninstalling from Apps and feature. Fixed installer version 1.3.14.42 | Implemented in Win*10 Releases version 2.2.1.384 20H1 certified |